AD-A079 895

TECHNICAL REPORT ARCSL-TR-79065

IGNITION OF ARTILLERY TRACERS
MANUFACTURED WITH KNOWN DEFECTS

TECHNICAL LUBRARY

by

Gerald C. Holst, Ph.D.

Research Division

November 1979



US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND
Chemical Systems Laboratory
Aberdeen Proving Ground, Maryland 21010



DITO QUALITY INDESCRED &

Approved for public release; distribution unlimited.

Disclaimer

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

Disposition

Destroy this report when it is no longer needed. Do not return it to the originator.

DEPARTMENT OF THE ARMY CHEMICAL SYSTEMS LABORATORY ABERDEEN PROVING GROUND, MARYLAND 21010

ERRATUM SHEET

Report No.:

ARCSL-TR-79065

Title:

Ignition of Artillery Tracers Manufactured with Known Defects

Author:

Gerald C. Holst, Ph.D.

Date:

November 1979

Classification:

Unclassified

This report was forwarded to your installation in December 1979.

Please insert this page into ARCSL-TR-79065 as part of page 3.

Acknowledgment

Mr. Thomas Doris recommended that the M13 tracer capsule be tested. He provided the rationale for choosing the particular defects used in this study and was instrumental in obtaining the defective tracers from Lone Star Army Ammunition Plant. The literature he supplied was the basis for the experiments performed in this study.

HENRY J. BIELECKI

Chief, Technical Releases Branch Developmental Support Division SECURITY CLASSIFICATION OF THIS PAGE (When Deta Entered)

REPORT DOCUMENTATION		READ INSTRUCTIONS BEFORE COMPLETING FORM
. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
ARCSL-TR-79065		
. TITLE (and Subtitle)		S. TYPE OF REPORT & PERIOD COVERED
		Technical Report
IGNITION OF ARTILLERY TRACERS MAN	UFACTURED WITH	October 1976 - February 1979
KNOWN DEFECTS		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(a)		8. CONTRACT OR GRANT NUMBER(s)
Gerald C. Holst		
PERFORMING ORGANIZATION NAME AND ADDRESS		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
Commander/Director, Chemical Syst	ems Laboratory	AREA & WORK DAIL NUMBERS
ATTN: DRDAR-CLB-PS		D : 1 3-360600-554
Aberdeen Proving Ground, Maryland	21010	Project 1L162622A554
1. CONTROLLING OFFICE NAME AND AODRESS		12. REPORT DATE
Commander/Director, Chemical Syst	ems Laboratory	November 1979
ATTN: DRDAR-CLJ-R		13. NUMBER OF PAGES
Aberdeen Proving Ground, Maryland	21010	22
14. MONITORING AGENCY NAME & AODRESS(If different	nt from Controlling Office)	15. SECURITY CLASS. (of this report)
		UNCLASSIFIED
		150. DECLASSIFICATION/DOWNGRAOING
		NA

Approved for public release; distribution unlimited.

- 17. OISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)
- 18. SUPPLEMENTARY NOTES
- 19. KEY WOROS (Continue on reverse side if necessary and identify by block number)

Tracers
Pyrotechnics
Ignition
CO2 laser ignition

20. ABSTRACT (Continue on reverse side if necessary and identify by block number)

The need exists for a reliable, inexpensive method of testing artillery tracers for ignitability and burn rate prior to expensive field tests. In this study, a 1-kw CO_2 laser was used to ignite tracers having known defects. The most sensitive measure appears to be the energy required for ignition. Results indicate that tracers manufactured with variations in the igniter percent of graphite exhibit a large dispersion in energy required for ignition. Tracers manufactured with variations in the tracer magnesium granularity also exhibit (Continued on reverse side)

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

20. ABSTRACT (Continued)

large dispersion. However, there appears to be a direct relationship between energy required and consolidation pressure. Low consolidation pressure tracers require more energy than do standard tracers.

PREFACE

This work was initiated at Frankford Arsenal in October 1976. Because those tracers manufactured with known defects were not available until after Frankford Arsenal closed in October 1977, the project was transferred to Chemical Systems Laboratory where it was completed in February 1979.

Reproduction of this document in whole or in part is prohibited except with permission of the Commander/Director, Chemical Systems Laboratory, ATTN: DRDAR-CLJ-R, Aberdeen Proving Ground, Maryland 21010. However, the Defense Documentation Center and the National Technical Information Service are authorized to reproduce the document for United States Government purposes.

CONTENTS

,		Page
ī.	INTRODUCTION	7
II.	ENPERIMENTAL PROCEDURE	9
III.	RESULTS	12
IV.	DISCUSSION OF RESULTS	15
v.	CONCLUSIONS	17
VI.	RECOMMENDATIONS	17
	DISTRIBUTION LIST	19
	LIST OF TABLES	
Table		
1	Description of Ml3 Tracers	9
2	Pyrotechnic Composition of Ml3-Type Tracers	10
3	Delay Time Measured for Each Tracer Lot	12
4	Average Ignition Delay Time and Standard Deviation	13
5	Expected Delay Times	16
6	Percent of Tracers Ignited for Various Incident Energy Levels	16
	LIST OF FIGURES	
Figur	ce	
1	Experimental Setup Used for Igniting M13 Tracers	11
2	Probability of Ignition As a Function of Consolidation Pressure	13
3	Probability of Ignition As a Function of Magnesium Granularity	14
4	Probability of Ignition As a Function of Percent by Weight of Graphite	14
5	Average Delay Time As a Function of Consolidation Pressure	15

IGNITION OF ARTILLERY TRACERS MANUFACTURED WITH KNOWN DEFECTS

I. INTRODUCTION.

Tracers for artillery rounds are pyrotechnic compositions housed within steel containers that are affixed by various means to the base of the projectile. These tracers are ignited by the hot gases in the gun chamber, and the smoke and flame produced allow personnel to perceive the trajectory of the projectile. The need for a reliable method of testing these tracers for ignitability and burn rate prior to field tests was made obvious by the number of rejections that appeared. The current quality-control acceptability criteria is that a single failure in a 10-round test lot, blind or short trace, is sufficient cause for rejecting the entire lot. If a double-sample method is used, then the lot may be accepted if an additional 25 rounds are tested and all perform satisfactorily. The trade off is between the cost of testing an additional 25 rounds and the cost associated with rejecting an entire lot.

The purpose of this study was to evaluate a method of testing the tracers during manufacture so that any deviations in the process may be corrected before the entire lot is completed. As a result, this type of test would, hopefully, significantly lower the scrap rate and lead to a high acceptance rate during expensive field trials.

The possible causes of blinds and short burn rates must be considered before a laboratory measurement is attempted because ignition in free air is a radical departure from the gun-chamber environment. Within the chamber, it may be assumed that the tracer is uniformly irradiated by a blackbody heat source. Furthermore, only a finite amount of energy is available for ignition. If the tracer has a manufacturing defect such that more energy is required, then the tracer will not ignite within the chamber. To detect this type of deficiency in the laboratory, it is necessary to uniformly irradiate the tracer with a controllable heat source. To this end, a 1-kw CO₂ laser was used. It is recognized that the energy absorbed depends upon the reflectivity of the surface; and since the reflectivity is a function of wavelength, the incident energy required for ignition from a CO₂ laser may be different from the broadband energy available within a gun chamber. However, for comparative results, the CO₂ laser will suffice.

Short burns may result from improper stoichiometric mix: voids within the tracer or a heterogeneous mixture. The effects of these defects will depend upon the spin rate. Initially, in this study the tracers were placed in an air-driven rotor capable of spinning up to 30,000 rpm to simulate actual firing conditions.

The use of a CO₂ laser to ignite tracers is not new. Several other investigators*, ** have attempted to ignite tracers with this controllable source and to study the effect of spin rate, burn time, and ignitability. Although the results indicate that there is a correlation between ignitability and stimulus intensity, no comprehensive test has been performed with tracers having known defects. The test procedure used by Platt* to ignite 5.56-mm tracer bullets is similar to the test procedure used in this study. However, the defective tracers used by Platt were listed only as 100%, 86%, 62%, and 50% weapon performance level lots. performance level was obtained by grouping all defects (blinds, short traces, long-ignition burns) together. It is not known why these particular tracers were defective in terms of chemical composition, consolidation pressure, etc.; therefore, it is not known how to avoid these unidentified manufacturing defects. Furthermore, to ignite the tracer Platt had to focus the laser down to a 2.5-mm-diameter beam to increase the laser power density. Any small surface irregularity could cause a significant difference in ignitability.

As already mentioned, the amount of energy absorbed depends upon the reflectivity. It has been experimentally observed that a pyrotechnic composition containing a high percentage of magnesium requires more energy for ignition than does a low percentage composition.** Supposedly, this was caused by the high reflectivity of magnesium at $10.6\,\mu\mathrm{m}$.

In an in-depth study, Puchalski*** sought to maximize burn time and candlepower output. He also studied the relationship between burning time and spin rate. Although he tried to optimize the composition, it can be inferred from his data how burn time may be affected by what we classify as an improper mixture; but to insure ignition 100% of the time, he affixed an electrosensitive composition onto the tracer igniter and used a Telsa coil to start the reaction. Therefore, there is no way of determining how sensitive the various compositions were to thermal energy.

In this study, we tried to avoid the possible errors discussed above. Tracers manufactured with known defects were uniformly irradiated by a 1-kw CO_2 laser. A parametric study was conducted with burn time, spin rate, and delay time as variables. Delay, defined as the time from initial laser irradiation to ignition, is related to the incident energy required for ignition.

^{*}Platt, W. G. Remington Arms Company, Bridgeport, Connecticut. Final Summary Report, Phase I. Contract DAAA25-71-C0069. Tracer Simulation Study. April 1972.

^{**}Ward, J. R., Pahel, R. K., and White, K. J. Laser Ignition of Pyrotechnic Compositions Being Tested As Drag Reducing Fumers. AD 765415. July 1973.

^{***}Puchalski, W. J. Frankford Arsenal Report FA-TR-74011. The Effects of Angular Velocity and Composition on Pyrotechnic Performance. August 1974.

II. EXPERIMENTAL PROCEDURE.

For these tests, the M13 tracer was chosen. It consists of a steel cup 1.9 cm in diameter and 1.75 cm long. It is charged with tracer composition R-508 and igniter I-527. Eight lots of the tracers were manufactured by the Lone Star Army Ammunition Plant, Texarkana, Texas. Seven lots had known defects; the eighth was manufactured in the normal manner (table 1).

Lot	Lot number	Consolidation pressure	Igniter percent graphite	Magnesium sieve size**
1.	LS-78F001S096	kpsi	*	*
2.	LS-78F001S097	50 75	*	*
3.	LS-78F001S098	75 25	*	*
4.	LS-78F001S099	*		*
5.	LS-78F001S100	*),	*
6.	LS-78F001S101	*	*	All fine (200/325 only)
7.	LS-78F001S102	*	*	All coarse (100/200 only)
8.	LS-52-10 sublot 5	100	2	100/200 and 200/325

Table 1. Description of M13 Tracers

Lots 1, 2, and 3 were designed to evaluate the effects of consolidation pressure. Lots 4 and 5 evaluate possible irregularities in the igniter, and lots 6 and 7 are possible irregularities in the tracer magnesium particle size. Lot 8 is a standard tracer. The chemical composition of a standard tracer is given in table 2.

^{*}Standard pressure, graphite or magnesium, as given by standard tracer LS-52-10 sublot 5.

^{**200/325} Represents particle sizes that pass through No. 200 sieve but are retained by No. 325 sieve.

Table 2. Pyrotechnic Compositions of M13-Type Tracers

Charge	Chemical	Weight
Tracer R-508	Magnesium 100/200* Magnesium 200/325* Strontium nitrate Vinylalcohol acetate resin Dechlorane	% 21 21 44 7 7
Igniter I-527	Barium peroxide Magnesium 200/325* Calcium resinate Graphite	77.5 15.5 5 2

^{*100/200} Represents particle sizes that pass through a No. 100 sieve but are retained by a No. 200 sieve.

The experimental setup is shown in figure 1. The relative brightness of each tracer was obtained with a silicon diode-filter system which had a spectral response equivalent to the standard photopic observer. Each tracer was irradiated for 1 second by a 1000-watt $\rm CO_2$ laser. The $\rm 1/e^2$ beam diameter was equal to the tracer diameter (1.9 cm). The average power density was approximately 350 w/cm². The entire exposed area (2.84 cm²) of the tracer was irradiated. No attempt was made to increase the absorption of the $\rm CO_2$ laser. The air-driven spinner could rotate up to 30,000 rpm.

Initially, the following parameters were investigated: (1) delay time between initial laser irradiation and tracer ignition time, (2) tracer burn time, (3) tracer intensity, and (4) effects of rotation.

Preliminary tests indicated that the intensity was approximately equal for all tracers (standard and defective). Furthermore, at any particular spin rate the burn time for all tracers was also approximately equal. The duration of the burn time depended upon the spin rate, and a "cone" of the unburned pyrotechnic material was usually ejected. The effects of rotation and "cone" ejection are discussed in detail by Puchalski* and will not be repeated in this report. Only the delay time was sufficiently sensitive to warrant further investigation. Therefore, this test applies only to the determination of possible blind tracers.

^{*}Puchalski, W. J. Frankford Arsenal Report FA-TR-74011. The Effects of Angular Velocity and Composition on Pyrotechnic Performance. August 1974.

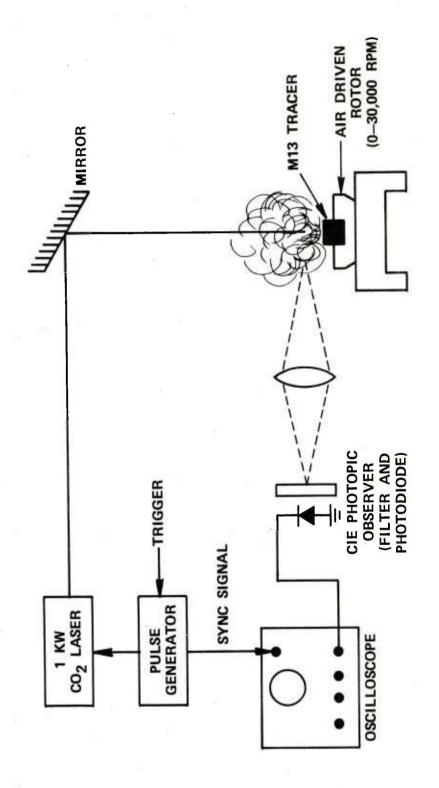


Figure 1. Experimental Setup Used for Igniting ML3 Tracers

III. RESULTS.

The delay time between initial laser irradiation and ignition is given in table 3. Since the laser is on for 1 second, the total energy required to ignite the tracer is simply

$$E = PT (1)$$

where P = the laser power (1000 watts)

and T = the delay time

Table 3. Delay Time Measured for Each Tracer Lot

	Lot numbers								
Standard	S096	S097	S 098	5099	S100	S101	S102		
200; 380 240; 400 240; 400 240; 400 240; 400 260; 400 300; 400 300; 440	440 680 700 700 700 760 850 880	500 520 600 640 650 700 700 800	600 640 760 760 760 760 760 800	msec 300 400 520 600 620 640 640 700	280 300 300 440 600 600 600 800	280 300 300 400 400 400 600	240 440 600 640 640 700 700 800		
300; 440 300; 440 300; 440 300; 480 360; 500 380; 500	900	800 800	840 860	760	800 820	750 800	820 840		

Table 4 gives the mean and standard deviations of the delay time for each lot. The data are assumed to be normally distributed, and the probability of ignition for each lot as a function of delay time is shown in figures 2 through 4. The curves are drawn so that the total area under the curve is equal to unity. The brightness of each tracer seemed to be independent of the lot and appeared to be constant.

Table 4. Average Ignition Delay Time and Standard Deviation

Lot number	Number tested	Average delay time	Standard deviation of delay time
S096 S097 S098 S099 S100 S101 S102 Standard	9 10 10 9 10 10 10	msec 734 671 758 576 554 483 642 356	msec 140 111 81 149 215 191 185 87

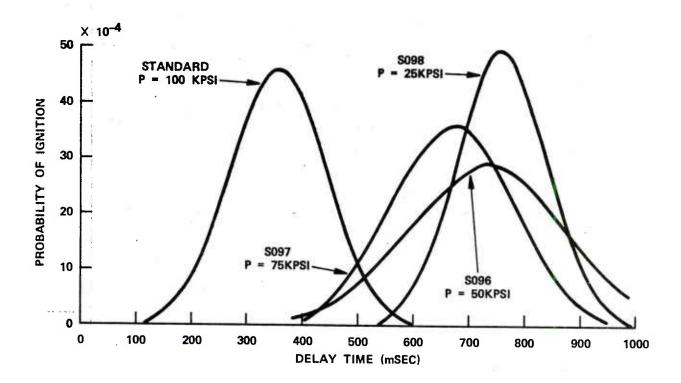


Figure 2. Probability of Ignition As a Function of Consolidation Pressure

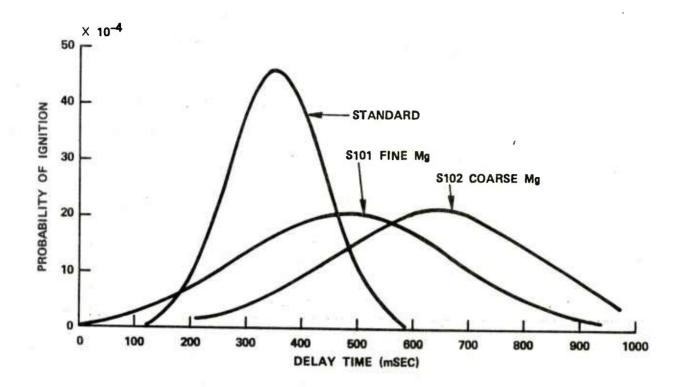


Figure 3. Probability of Ignition As a Function of Magnesium Granularity

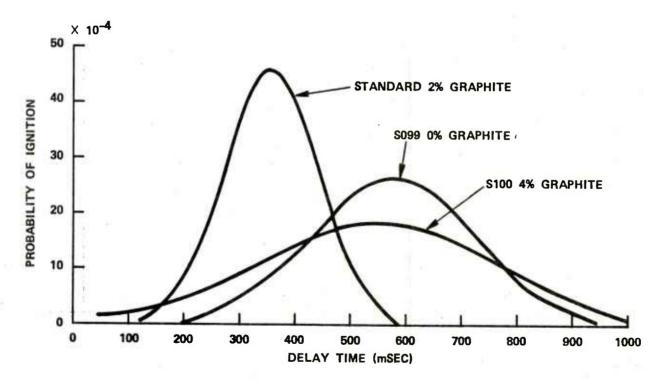


Figure 4. Probability of Ignition As a Function of Percent by Weight of Graphite

IV. DISCUSSION OF RESULTS.

It may be argued that the total number of tracers sampled was not sufficient to apply reasonable statistics. On the other hand, when tracers are fired in the field, only 10 rounds are fired and the results of those 10 rounds are sufficient to accept or reject an entire lot. If this type of test is used during manufacturing to control processing, only a few would be tested. The delay-time determination appears to be a sensitive method of evaluating consolidation pressure. Figure 5 is a plot of the average delay time versus consolidation pressure. If it is arbitrarily stated that the maximum delay time of 500 msec would be acceptable then, on the average, any tracer with a loading pressure below 90 kpsi would be rejected. If this method is considered for manufacturing control, statistical analysis would be used to determine the maximum allowable delay time. The critical assumption in these experiments is that the reflectivity of the exposed surface at 10.6 µm is not affected during the manufacture of the defective tracers. Since delay time is related to total energy, the total energy given to the tracer is 500 joules for a 500-msec delay. If heat conduction is not significant, the relationship between incident laser power and delay time (table 5) can be calculated from equation (1). Thus, if a lower-powered laser is used, the expected delay time increases.

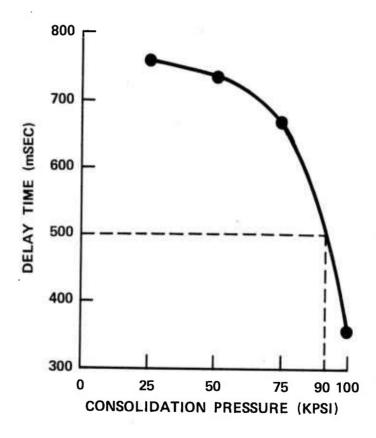


Figure 5. Average Delay Time As a Function of Consolidation Pressure

Table 5. Expected Delay Times

Laser power	Ignition delay time
w	sec
1000	0.5
500	1.0
250	2.0

It may be possible to reduce the laser power even further by focusing down to a smaller laser spot. However, surface irregularities and imperfections may lead to inconsistent data.

The percent of graphite and the granularity of magnesium exhibited a large dispersion in delay times which are quite difficult to explain. The standard deviations of these tests were much larger than the consolidation pressure defectives. Since the defects required a special manufacturing process, it may be exactly this process that leads to blind tracers.

When any upper bound is used to separate good items from bad items, and only a few items are tested, there is always a probability that a good lot may be rejected and a bad lot may be accepted. It is recognized that an insufficient number of tracers have been tested to accurately define the mean or the standard deviation of the overall population. The standard deviation is very sensitive to the sample size; and in this study, the sample size was rather small. Nevertheless, if the statistics obtained are representative of the population and if the delay time was truly the reason for blind tracers, then we can estimate the percentage of tracers that will ignite out of the total population for each type of defect for various incident energies (table 6). For example, if 4.7% of lot S096 ignited during field tests, then we would expect 6.2% of lot S097, 0.1% of lot S098, and so on to ignite. On the other hand, if 97.1% of lot S096 ignited then all other lots would also exhibit a high probability of ignition. If this is the case, then the energy available within the chamber is sufficient to ignite all tracers tested in this study.

Table 6. Percent of Tracers Ignited for Various Incident Energy Levels

Energy available		Lot number						
for ignition	S096	S097	S098	8099	S100	S101	S102	Standard
Joules			1	7/8				%
500 600 700 800 900 1000	4.7 16.9 40.5 68.1 88.3 97.1	6.2 26.1 60.3 87.7 98.0 99.8	0.1 2.8 23.9 69.8 96.0 99.9	30.5 56.4 79.7 93.3 98.4 99.8	40.1 58.3 75.2 87.3 94.6 98.1	53.6 72.9 87.3 95.2 98.5	22.1 40.9 62.2 80.2 91.9 97.4	95.2 99.8 99.9+ 99.9+ 99.9+

V. CONCLUSIONS.

These data show that more energy is required to ignite low consolidation pressure tracers. If blinds are caused by low consolidation pressure, then ignition testing with a $\rm CO_2$ laser is a viable method to control manufacturing. It is economically feasible to subject a large number of tracer capsules to laboratory tests to obtain a significantly large statistical sample size for quality-control purposes.

For us to understand why such a large standard deviation appeared in the delay-time data, we should carefully evaluate the process which was used in the manufacture of the percent of graphite and magnesium granularity defectives. Since the defects required a special manufacturing process, it may be exactly this process that leads to blind tracers.

The known defects tested (consolidation pressure, percent of graphite, and granularity of magnesium) do not appear to significantly affect burn intensity or burn time. Other possible defects, such as inhomogeneous mix or voids, should be tested by this method to determine how they might affect burn intensity or burn time.

VI. RECOMMENDATIONS.

It is recommended that samples from the eight lots tested here be subjected to field tests to verify the findings presented here. In particular, lot S098 should be tested first because it is the most sensitive to the energy available for ignition. If this lot does not exhibit any blind tracers, it suggests that the energy within the chamber is greater than 1000 joules. Table 6 shows that at 1000 joules, all defective lots have a high probability of ignition. Therefore, if lot S098 ignites each time, no further field testing is recommended. It indicates that laboratory test procedures are more sensitive to the defects tested in this study than are field tests.

DISTRIBUTION LIST 6

Names	Copies	Names	Copies
CHEMICAL SYSTEMS LABORATORY		Deputy Chief of Staff for Research, Development & Acquisition	
SAFETY OFFICE		Attn: DAMA-CSM-CM	1
Attn: DRDAR-CLF	1	Attn: DAMA-ARZ-D	1
AUTHOR'S COPIES: Research Division	20	Washington, DC 20310	
		US Army Research and Standardization	
USA BIOMEDICAL LABORATORY		Group (Europe)	1
Attn: SGRD-UV-ZA	1	Attn: Chief, Chemistry Branch Box 65, FPO New York 09510	
DEVELOPMENTAL SUPPORT DIVISION			
Attn: DRDAR-CLJ-R	3	HQDA (DAMI-FIT)	1
Attn: DRDAR-CLJ-L	3	WASH, DC 20310	
Attn: DRDAR-CLJ-M	_ 1		
Attn: DRDAR-CLJ-P	1	Commander	
		HQ US Army Medical Command, Europe	1
MUNITIONS DIVISION	_	Attn: AEMPM APO New York 09403	1
Attn: DRDAR-CLN	5	APO New 101k U94U3	
RESEARCH DIVISION		US ARMY HEALTH SERVICE COMMAND	
Attn: DRDAR-CLB	1		
Attn: DRDAR-CLB-B	1	Superintendent	
Attn: DRDAR-CLB-C	1	Academy of Health Sciences	
Attn: DRDAR-CLB-P	1	US Army	
Attn: DRDAR-CLB-R	1	Attn: HSA-CDC	1
Attn: DRDAR-CLB-T	1	Attn: HSA-IHE	1
Attn: DRDAR-CLB-TE	1	Fort Sam Houston, TX 78234	
SYSTEMS DEVELOPMENT DIVISION		US ARMY MATERIEL DEVELOPMENT AND	
Attn: DRDAR-CLY-A	1	READINESS COMMAND	
Attn: DRDAR-CLY-R	1	Comments	
		Commander	
DEPARTMENT OF DEFENSE		US Army Materiel Development and Readiness Commar Attn: DRCLDC	1
Administrator		Attn: DRCSF-P	1
Defense Documentation Center		5001 Eisenhower Ave	
Attn: Document Processing Division (DDC-DD)	12	Alexandria, VA 22333	
Cameron Station			
Alexandria, VA 22314		Commander	
Pi		US Army Toxic & Hazardous Materials Agency	
Director Defense Intelligence Agency		Attn: DRXTH-TS	2
Attn: DB-4G1	1	Aberdeen Proving Ground, MD 21010	_
Washington, DC 20301	1	, <u></u>	
washington, DC 20301		Project Manager Smoke/Obscurance	
DEPARTMENT OF THE ARMY		Attn: DRCPM-SMK-M	1
		Aberdeen Proving Ground, MD 21005	
HQDA (DAMO-SSC)	1		
WASH DC 20310		Human Engineering Laboratory HFE Detachment Attn: DRXHE-EA	1
Director		Building E3220	
Defense Civil Preparedness Agency		Aberdeen Proving Ground, MD 21010	
Attn: PO(DC)	1		
Washington, DC 20301	-	Commander	
		US Army Foreign Science & Technology Center	
CINCUSAREUR		Attn: DRXST-MT2	1
Attn: AEAGC-RSI	1	220 Seventh St., NE	
APO New York 09403		Charlottesville, VA 22901	

DISTRIBUTION LIST 6 (Contd)

Names	Copies	Names	Copies
US Army Materiel Systems Analysis Activity		Commander	
Attn: DRXSY-MP	1	Rocky Mountain Arsenal	
Attn: DRXSY-T (Mr. Kaste)	1	Attn: SARRM-OA	
Aberdeen Proving Ground, MD 21005	•	Commerce City, CO 80022	1
Director		Commander	
DARCOM Field Safety Activity		Pine Bluff Arsenal	
Attn: DRXOS-C	1	Attn: SARPB-ETA	1
Charlestown, IN 47111		Pine Bluff, AR 71611	1
US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND		US ARMY TRAINING & DOCTRINE COMMAND	
Commander		Commandant	
US Army Armament Research and Development Comr	nond	US Army Infantry School	
Attn: DRDAR-AC		Attn: NBC Division	1
Attn: DRDAR-LCA	1 1	Fort Benning, GA 31905	
Attn: DRDAR-LCU	1	Commandant	
Attn: DRDAR-SCA-C	1	Commandant	
Attn: DRDAR-SCP-A	1	US Army Missile & Munitions Center & School Attn: ATSK-CD-MD	
Attn: DRDAR-SCW	1	Attn: ATSK-CD-MD Attn: ATSK-DT-MU-EOD	1
Attn: DRDAR-SER	ī	Redstone Arsenal, AL 35809	1
Attn: DRDAR-TSS	2	Medicine Alsonal, AL 53803	
Dover, NJ 07801		Commandant	
		US Army Military Police School/Training Center	
Commander		Attn: ATZN-CDM	_ 1
Armament Concepts Office, Systems Concepts Team		Attn: ATZN-TDP-C	4
Attn: DRDAR-ACW	1	Fort McClellan, AL 36205	7
Aberdeen Proving Ground, MD 21010			
Director		Commander	
Ballistic Research Laboratory		US Army Infantry Center	
Attn: DRDAR-TSB-S		Attn: ATSH-CD-MS-C	1
Building 305	2	Fort Benning, GA 31905	
Aberdeen Proving Ground, MD 21005			
21003		Commandant	
CDR, APG		US Army Ordnance & Chemical Center & School	
USA ARRADCOM		Attn: ATSL-CL-CD	1
Attn: DRDAR-GCL	1	Aberdeen Proving Ground, MD 21005	
Aberdeen Proving Ground, MD 21010		Common do	
		Commander USA Training & Doctrine Command	
US ARMY ARMAMENT MATERIEL READINESS CO	MMAND	Attn: ATCD-Z	1
Commander		Fort Monroe, VA 23651	
US Army Armament Materiel Readiness Command		Commander	
Attn: DRSAR-LE	1		
Attn: DRSAR-PDM	1	USA Combined Arms Combat Development Activity Attn: ATZLCA-CO	
Attn: DRSAR-PE	1	Fort Leavenworth, KS 66027	1
Attn: DRSAR-SF	1	Total Deaven worth, RS 60027	
Rock Island, IL 61299		US ARMY TEST & EVALUATION COMMAND	
CDR, APG		Commondo	
USA ARRCOM		Commander US Army Test & Evaluation Command	
Attn: SARTE	1	Attn: DRSTE-FA	
Aberdeen Proving Ground, MD 21010	-	Aberdeen Proving Ground, MD 21005	1
Commander			
US Army Dugway Proving Ground			
Attn: Technical Library, Docu Sect	1		
Dugway, UT 84022	-		

DISTRIBUTION LIST 6 (Contd)

Names	Copies	Names	Copies
DEPARTMENT OF THE NAVY		Director of Toxicology	1
		National Research Council	•
Commander		2101 Constitution Ave, NW	
Naval Explosive Ordnance Disposal Facility		Washington, DC 20418	
Attn: Army Chemical Officer, Code 604	1		
Indian Head, MD 20640			
•		ADDITIONAL ADDRESSEES	
Commander			
Nuclear Weapons Training Group, Atlantic		Commandon	
Naval Air Station		Commander USEUCOM	
Attn: Code 21	1		
Norfolk, VA 23511		Attn: ECJ-O/LTC James H. Alley APO, NY 09128	1
•		APO, NT 09128	
Chief, Bureau of Medicine & Surgery	1	US Public Health Service	
Department of the Navy	. –		1
Washington, DC 20372		Room 17A-46 (CPT Osheroff)	1
5 ,		5600 Fishers Lane	
Commander		Rockville, MD 20857	
Naval Weapons Center			
Attn: A. B. Galloway/Code 3171	1	Commander	
China Lake, CA 93555	•	US Army Environmental Hygiene Agency	
Change Entry City 90000		Attn: Librarian, Bldg 2100	1
Commanding Officer		Aberdeen Proving Ground, MD 21010	
Naval Weapons Support Center			
Attn: Code 5042/Dr. B. E. Douda	1	Commander	
Crane, IN 47522	1	DARCOM, STITEUR	
Clalle, 114 4/322		Attn: DRXST-ST1	1
US MARINE CORPS		Box 48, APO New York 09710	
OS MARINE CORPS			
Director, Development Center		Commander	
Marine Corps Development & Education Command		US Army Science & Technology Center-Far East Office	1
Attn: Fire Power Division	1	APO San Francisco 96328	
Quantico, VA 22134	1		
Quantico, VA 22134		HQDA DASG-RDZ (SGRD-PL)	1
DEPARTMENT OF THE AIR FORCE		WASH DC 20314	
DEFARTMENT OF THE AIR PORCE			
HQ Foreign Technology Division (AFSC)		HQDA (SGRD-AJ/Mrs. Madigan)	1
Attn: PDRR	-1	Fort Detrick	
Wright-Patterson AFB, OH 45433	1	Frederick, MD 21701	
Wilght-Tattogson Ar B, Off 43433		·	
Commander		Commander	
Aeronautical Systems Division		Air Force Armament Laboratory	
Attn: ASD/AELD	1	Attn: Technical Library	1
Wright-Patterson AFB, OH 45433	1	Eglin Air Force Base, FL 32542	
might ratioson Ar B, Ott 45455			
HQ USAF/SGES	1	Commander	
Bolling AFB, DC 20332	1	US Naval Surface Weapons Center	
Jeaning 111 5, DC 2002		Attn: Technical Library	1
HQ AFISC/SEV	1	Silver Spring, MD 20910	
Norton AFB, CA 92409	•		
1,010,12,011		Commander	
OUTSIDE AGENCIES		US Naval Ordnance Station	
		Attn: Technical Library	1
Battelle, Columbus Laboratories		Indian Head, MD 20640	
Attn: TACTEC	1		
505 King Avenue	•	Commander	
Columbus, OH 43201		Radford Army Ammunition Plant	
		Attn: J. Horvath	1
		Radford, VA 24141	

DISTRIBUTION LIST 6 (Contd)

Names	Copies	Names	Copies
Commander			
Lonestar Army Ammunition Plant		Advanced Research Projects Agency	1
Attn: SARLS-O	2	1400 Wilson Boulevard	
Texarkana, TX 75501	2	Arlington, VA 22209	
·		Commander	
Commander		Harry Diamond Laboratories	
US Army Armament Research & Development Comman	d	Attn: DRXDO-RDC (D. Giglio)	1
Attn: DRDAR-SCA (Dr. D.A. Gyorog)	1	2800 Powder Mill Road	
Attn: DRDAR-SCA (C.J. Rhoades)	1	Adelphi, MD 20783	
Attn: DRDAR-SCS (H. Kahn)	1		
Attn: DRDAR-SCA (B.W. Brodman)	1	Chief, Office of Missile Electronic Warfare	
Attn: DRDAR-SCA (T. Doris) Attn: DRDAR-QAA	20	US Army Electronic Warfare Laboratory	
Attn: DRDAR-QAA Attn: DRDAR-SCA (R. Fedyna)	2	Attn: DRSEL-WLM-SE (K. Larson)	1
Attn: DRDAR-SCA (R. Fedyna) Attn: DRDAR-SCA (L. Stiefel)	1	White Sands Missile Range, NM 88002	
Attn: DRDAR-LC (Dr. J. Frasier)	1	0	
Attn: DRDAR-SCM-P (Dr. B. Ebihara)	1	Commander	
Dover, NJ 07801	•	US Army Armament Materiel Readiness Command Attn: DRSAR-LEP-L	1
,		Rock Island, IL 61299	1
Director		Nock Island, IL 01279	
Benet Weapons Laboratory		Director	
Attn: DRDAR-LCB (Dr. Igbal Ahmad)	1	US Army TRADOC Systems Analysis Activity	
Attn: DRDAR-LCB-TL	1	Attn: ATAA-SL (Tech Lib)	1
Watervliet, NY 12189		White Sands Missile Range, NM 88002	
Director			
US Army Ballistic Research Laboratories		Commander	
Attn: DRDAR-BLB (R. Reitz)	1	Air Force Armament Laboratory	
Attn: DRDAR-BLB (A. LaGrange)	i	Attn: D. Uhrig	1
Aberdeen Proving Ground, MD 21005	•	Attn: O.K. Heiney Eglin Air Force Base, FL 32542	1
,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,		Eguli All 1 Gloc Base, 1 E 32342	
Commander		Commander	
US Army Research Office - Durham	1	Naval Surface Weapons Center	
Box CM, Duke Station		Attn: M. Shamblem	1
Durham, NC 27706		Attn: J. O'Brasky	1
HO (DAWA ARZ Do W. do)		Attn: C. Smith	1
HQ (DAMA-ARZ, Dr. Verderame)	1	Dahlgren, VA 22448	
WASH, DC 20310		C Ima	
Commander		Commander/Director	
US Army Materiel Development and Readiness Comman	d	Chemical Systems Laboratory	
Attn: DRCDE-DM	1	Attn: DRDAR-CLG Attn: DRDAR-CLN-S	1 1
Attn: DRCMT	1	Aberdeen Proving Ground, MD 21010	1
Attn: DRCSI-S	1	Moducon Floring Glound, MD 21010	
Attn: DRCDL (N. Klein)	1	Commander	
Attn: DRCBI (COL Gearin)	1 ,	Naval Surface Weapons Center	
Attn: DRCDMD-ST (T. Shirata)	1	Attn: Tech Lib & Info Svcs Br	1
5001 Eisenhower Ave		White Oak Laboratory	
Alexandria, VA 22333		Silver Spring, MD 20910	
Commander			
US Army Foreign Science & Technology Center		Commander	
Attn: DRXST-CF (V. Rague)	1	Naval Surface Weapons Center	
220 Seventh St., NE	•	Dahlgren Laboratory Attn: DX-21	1
Charlottesville, VA 22901		Dahlgren, VA 22448	1
		www.gavas, Til wartU	
Commander		Commander	
US Army Missile Command	_	Armament Development & Test Center	
Attn: Chief, Documents	1	Attn: DLOSL (Technical Library)	1
Redstone Arsenal, AL 35809		Eglin AFB, FL 32542	